


**MARKINGS:**

A1-A2-A3	0%
B1-B2-B3	50%
C1-C2-C3	65%
D1-D2-D3	80%
H1-H2-H3	100%

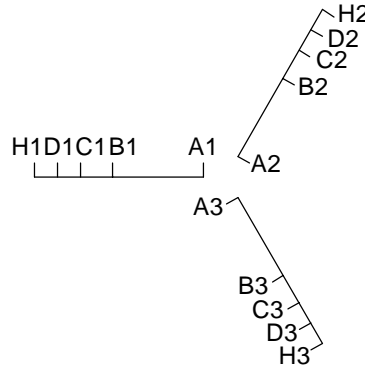

**3 PHASE MOTOR STARTING  
AUTO-TRANSFORMER  
TYPE: ANN-SELF COOLED**

CAT.NO.:	RS100J
HP:	100
VOLTAGE SYSTEM:	600 V
TAPS:	0, 50%, 65%, 80%, 100%
<b>DUTY:</b>	
ON:	15 Seconds
OFF:	3 Minutes 45 Seconds
REPEAT:	15 Cycles - For automatically operated starter 4 Cycles - For Manually operated starter
REST:	2 Hours
ON:	15 Seconds
OFF:	3 Minutes 45 Seconds
REPEAT:	15 Cycles - For automatically operated starter 4 Cycles - For Manually operated starter


A	B	C	D	E
DIMENSIONS			MOUNTING	
12.00	10.75	10.50	8.00	6.25

INSULATION CLASS:	220° C
FREQUENCY:	50/60 Hz.
COILS:	COPPER
WEIGHT:	150 Lbs

TERMINATION: COPPER PADS

**STANDARDS:**  
-CSA CERTIFIED  
-UL LISTED

**SPECIAL FEATURE:**  
-NC 200°C THERMOSTAT ON CENTRE COIL

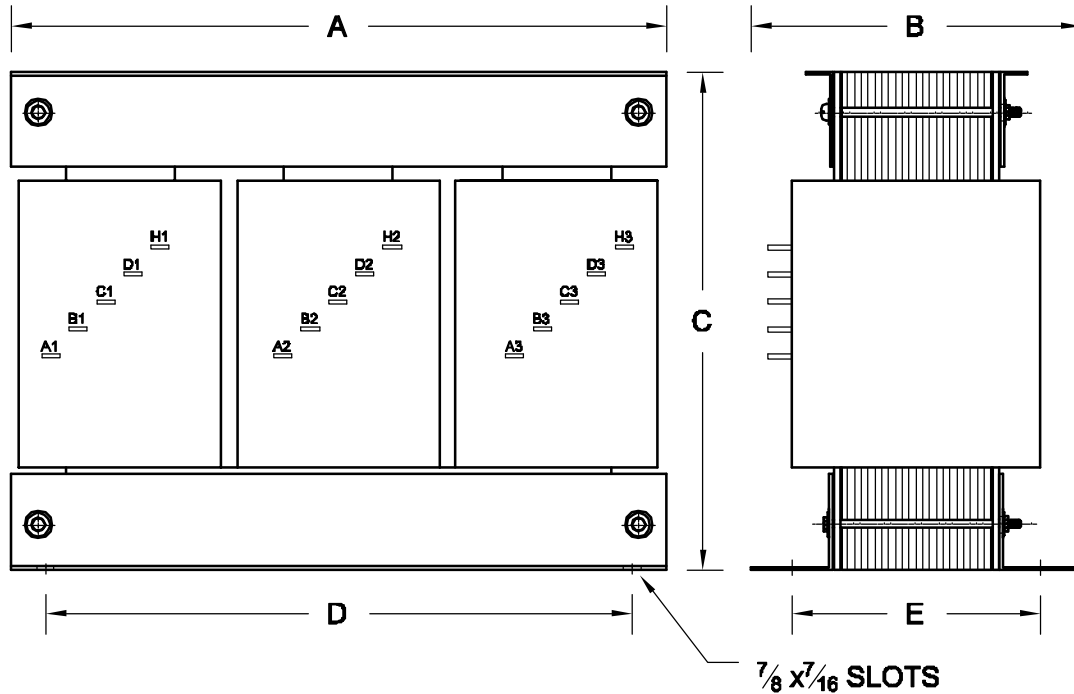

REV.	REMARKS	BY:	DATE:
<b>REX MANUFACTURING</b> DIVISION OF TRANSFACTOR INDUSTRIES INC.			
DRAWN BY:	SARKIS	DATE:	AUGUST 4, 2004
CHECKED BY:	V.S.	DATE:	AUGUST 4, 2004
TITLE: MOTOR STARTING AUTO-TRANSFORMER OUTLINE 3 PHASE, 100 HP, 600 V			
SCALE:	N.T.S.	DRAWING NAME:	